


Packing Pieces for Types A and B

These packing pieces are compatible with the Type A and Type B clamps and are used to increase the clamping range to suit flange thicknesses. Types A and B are available with three different tail lengths (short, medium or long) and the correct combination of packing pieces should be used.

Packing Pieces


Type CW

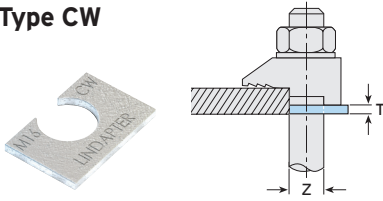

Mild steel, zinc plated / hot dip galvanized.

Product Code	Bolt Size Z	Dimension T
LCW037	3/8"	1/16"
LCW050	1/2"	1/8"
LCW062	5/8"	1/8"
LCW075	3/4"	3/16"
LCW100	1"	3/16"

Type P1 short / Type P2 short

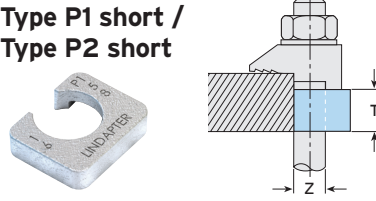


Mild steel, malleable iron, zinc plated / hot dip galv.

Product Code	Bolt Size Z	Dimension T
LP1037S	3/8"	3/16"
LP1050S	1/2"	1/4"
LP1062S	5/8"	5/16"
LP1075S	3/4"	3/8"
LP1100S	1"	1/2"
LP2037S	3/8"	3/8"
LP2050S	1/2"	1/2"
LP2062S	5/8"	5/8"
LP2075S	3/4"	3/4"
LP2100S	1"	1"

Also Available

Type W

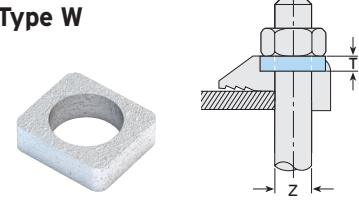

Mild steel, malleable iron, zinc plated / hot dip galv.

Product Code	Bolt Size Z	Dimension T
LW037	3/8"	3/16"
LW050	1/2"	1/4"
LW062	5/8"	5/16"
LW075	3/4"	3/8"


Note: Type W is used to fill the recess in the Type A to convert it into a flat top clamp which enables an A325 structural bolt head or nut to be rotated.

Tail Length / Packing Piece Combinations for Types A and B

Choose the correct combination for your Type A/B configuration using the table below. Please note these calculations are for beams up to and including 5° slopes only.

For example, a 5/8" Type A/B on a 1 1/8" flange requires 1 x Type A/B short tail (S), 2 x Type CW and 1 x Type P2S.

▶ For thicker flanges contact Lindapter.

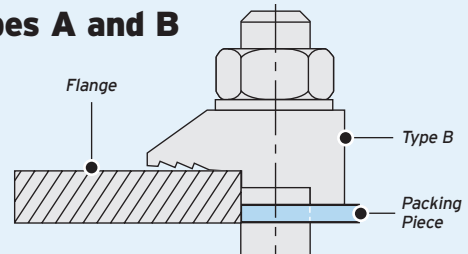

Flange Thickness	3/8"				1/2"				5/8"				3/4"				1"			
	A/B	CW	P1S	P2S	A/B	CW	P1S	P2S	A/B	CW	P1S	P2S	A/B	CW	P1S	P2S	A/B	CW	P1S	P2S
3/16"	M	-	-	-	S	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-
1/4"	S	1	-	-	M	-	-	-	S	-	-	-	S	-	-	-	-	-	-	-
5/16"	L	-	-	-	M	1	-	-	M	-	-	-	S	-	-	-	S	-	-	-
3/8"	S	-	1	-	L	-	-	-	S	1	-	-	M	-	-	-	S	-	-	-
7/16"	L	2	-	-	M	2	-	-	L	-	-	-	S	1	-	-	M	-	-	-
1/2"	L	3	-	-	S	1	1	-	S	2	-	-	L	-	-	-	M	-	-	-
9/16"	S	-	-	1	L	2	-	-	L	1	-	-	M	1	-	-	S	1	-	-
5/8"	S	1	-	1	L	-	1	-	M	-	1	-	L	1	-	-	L	-	-	-
11/16"	L	-	-	1	M	2	1	-	L	2	-	-	S	-	1	-	S	2	-	-
3/4"	S	-	1	1	S	1	-	1	L	-	1	-	S	3	-	-	L	1	-	-
13/16"	M	-	1	1	M	1	-	1	L	3	-	-	M	-	1	-	L	1	-	-
7/8"	L	-	1	1	S	-	1	1	M	2	1	-	M	3	-	-	S	-	1	-
15/16"	S	-	-	2	M	-	1	1	M	-	-	1	M	1	1	-	M	-	1	-
1"	M	-	-	2	S	1	1	1	L	2	1	-	S	2	1	-	S	1	1	-
1 1/16"	L	-	-	2	M	1	1	1	L	-	-	1	S	-	-	1	L	-	1	-
1 1/8"	L	1	-	2	S	-	-	2	S	2	-	1	M	2	1	-	L	-	1	-
1 3/16"	-	-	-	-	M	-	-	2	L	1	-	1	M	-	-	1	S	2	1	-
1 1/4"	-	-	-	-	S	1	-	2	M	-	1	1	S	1	-	1	L	1	1	-

A/B = Type A/B | S = Type A/B short | M = Type A/B medium | L = Type A/B long | CW = Type CW | P1S/P2S = Type P1/P2 short